

CUSTOMER #: 509623

291943

Porsche Centre Vancouver

688 Terminal Avenue
Vancouver, BC V6A 2M5
Telephone: (604) 736-7911
Fax: (604) 738-6511
Service Direct: (604) 730-2111
Service Toll Free: 1-855-950-7378 (SERV)
www.dilawri.ca

INVOICE

DUPLICATE 3
PAGE 1



BUS:		CELL:		SERVICE ADVISOR: 118 RAY OKUCHI				
COLOUR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
WHITE	96	PORSCHE GT2		WP0ZZZ99ZTS392104		29337/29355		T2104
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
31DEC96 DD		01JAN1998	17:00 21APR17		163.00	CASH	24APR17	
R.O. OPENED		READY		OPTIONS:				
12:07 02FEB17		13:20 24APR17						
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL	

A CLIENT STATES THAT ENGINE WARNING LAMP IS ILLUMINATED.

ENGINE CLIENT STATES THAT ENGINE WARNING LAMP IS ILLUMINATED.

4087	CPP		1080.69	1080.69
1	999-607-073-00 FUSE 40A	7.30	6.20	6.20
PARTS:	6.20	LABOR:	1080.69	OTHER: 0.00
29337			TOTAL LINE A:	1086.89

CONNECT BATTERY CHARGER, BATTERY VOLTAGE 14.5 VOLTS (27068553)
CREATE AND UPLOAD VAL. (03350050),
CHECK SYSTEM FOR FAULTS. (03350053),
CHECK ENGINE LIGHT;
-FOUND THE FOLLOWING FAULT CODES; -12 O2 SENSOR BEHIND CATALYST,
CYLINDERS 1-3,
-14 O2 SENSOR HEATER BEHIND CATALYST BANK 1,
-98 FUEL EVAPORATIVE VALVE,
-FOUND FUEL EVAPORATIVE VALVE WAS UNPLUGGED, RE & RE INTER COOLER &
PLUG IN ELECTRICAL CONNECTOR FOR EVAP VALVE,
-CLEAR FAULT CODES,
-CHECK FOR FAULT CODES AFTER REPAIR, FUEL EVAP VALVE FAULT CODE DID
NOT RETURN BUT THE FOLLOWING CODES WERE FOUND AFTER INITIAL REPAIR
-80 SECONDARY AIR INJECTION SYSTEM (CYLINDER 1-3),
-208 SECONDARY AIR INJECTION SYSTEM (CYLINDER 4-6),
-REQUIRES FURTHER TIME TO DIAGNOSE FOR O2 SENSOR & SECONDARY AIR
INJECTION SYSTEM FAULTS,
CHECK SECONDARY AIR INJECTION SYSTEM FUNCTION,
AIR PUMP DOES NOT RUN,
INSPECT AIR PUMP WIRING & FUSES,
FOUND AIR PUMP WIRING HARNESS INSULATION HAS DETERIORATED & BARE
WIRES ARE TOUCHING EACH OTHER,
FUSE FOR AIR PUMP IS BLOW & ENGINE COMPARTMENT FUSE BOX COVER IS
BROKEN,
RECOMMEND REPLACING SECONDARY AIR INJECTION PUMP, RELAY, FUSE &
COVER,
WILL NEED TO RE TEST AIR INJECTION SYSTEM FUNCTION AFTER REPAIRS &

WE HANDLE ALL ICBC REPAIRS		Monday to Friday 8:00 am - 5:30 pm	DESCRIPTION	TOTALS
			LABOUR AMOUNT	
ALL WORK PERFORMED BY OUR FACTORY TRAINED TECHNICIANS		<p>The personal information on this form and any personal information we presently have on file is collected, used and disclosed by us for the purpose of selling, leasing, financing, servicing, repairing, licensing and testing your vehicle, providing loaner vehicles, providing service reminders, obtaining insurance coverage for you, contacting you to provide you with information regarding products and services that may be of interest to you and providing any other products and services requested by you. By signing this form, you expressly consent and agree to the collection, use and disclosure as described above. If you do not consent, please discuss this with a service representative.</p>	PARTS AMOUNT	
			GAS	
			SUBLET AMOUNT	
			ENVIRONMENTAL LEVY / MISC.	
			TOTAL CHARGES	
			LESS INSURANCE	
			TOTAL SALES TAX	
			PLEASE PAY THIS AMOUNT	

CUSTOMER #: 509623

291943

Porsche Centre Vancouver

688 Terminal Avenue
Vancouver, BC V6A 2M5
Telephone: (604) 736-7911
Fax: (604) 738-6511
Service Direct: (604) 730-2111
Service Toll Free: 1-855-950-7378 (SERV)
www.dilawri.ca

INVOICE



DUPLICATE 3
PAGE 2

BUS:		CELL:		SERVICE ADVISOR: 118 RAY OKUCHI				
COLOUR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
WHITE	96	PORSCHE GT2		WP0ZZZ99ZTS392104		29337/29355		T2104
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
31DEC96 DD		01JAN1998	17:00 21APR17		163.00	CASH	24APR17	

R.O. OPENED		READY	OPTIONS:					
12:07 02FEB17		13:20 24APR17						
LINE OPCODE TECH TYPE HOURS			LIST		NET	TOTAL		

MAY STILL REQUIRE FURTHER REPAIRS,
PERFORM SECONDARY AIR INJECTION PUMP REPAIRS AS PER CUSTOMER,
RE & RE ENGINE AIR CLEANER,
RE & RE INTAKE MANIFOLD,
RE & RE SECONDARY AIR INJECTION PUMP,
REMOVE REAR COVER OF SECONDARY AIR INJECTION PUMP,
REMOVE OLD DETERIORATED INSULATION FROM AIR PUMP WIRING HARNESS,
APPLY HEAT SHRINK TUBING & BRUSHABLE ELECTRICAL TAPER TO WIRING HARNESS,
BENCH TEST AIR PUMP, WORKS OK AT PRESENT TIME,
REINSTALL AIR PUMP,
REPLACE 40AMP FUSE FOR AIR PUMP,
FOUND DURING REPAIRS THAT STEERING PUMP IS LEAKING OIL,
RE & RE STEERING PUMP COVERS,
RE TIGHTEN STEERING PUMP BOLTS TO SPEC,
NO FURTHER LEAKS FROM STEERING PUMP FOUND AFTERWARDS,
REPLACE WORN FAN SHROUD RUBBER BOOT,
REPLACE MISSING BOLTS FOR FAN SHROUD RUBBER BOOT,
REPLACE MISSING BOLT FOR AC COMPRESSOR BRACKET,
WENT TO REPLACE O2 SENSORS AFTER CATALYST & FOUND O2 SENSORS HAVE BEEN WELDED TO CATALYST PIPES,
REQUIRES REMOVAL OF CATALYSTS FROM VEHICLE, OLD O2 SENSORS REMOVED & NEW O2 SENSOR MOUNTINGS WELDED TO CATALYST PIPES,

B WHEN CLUTCH IS DEPRESSED - NOISE FROM CLUTCH			
4000 MISC DRIVELINE DIFF			
4087 CPP			
1 900-123-011-30 SEAL RING	7.30	6.20	6.20
1 201 80W90 SWEPCO	111.28	94.59	94.59
1 900-123-106-30 ALUM SEAL RING	5.52	4.69	4.69
1 997-116-086-90 AS RELEASE LEVER	351.77	299.00	299.00
1 950-116-715-01 BUSHING	9.72	8.26	8.26
1 950-116-725-00 CLUTCH SHAFT COVER	5.73	4.87	4.87
1 999-201-339-01 NEEDLE BEARING 4:1	14.69	12.49	12.49

WE HANDLE ALL ICBC REPAIRS		Monday to Friday 8:00 am - 5:30 pm	DESCRIPTION		TOTALS
			LABOUR AMOUNT		
ALL WORK PERFORMED BY OUR FACTORY TRAINED TECHNICIANS		Monday to Friday 8:00 am - 5:30 pm	PARTS AMOUNT		
			GAS		
			SUBLET AMOUNT		
			ENVIRONMENTAL LEVY / MISC.		
			TOTAL CHARGES		
			LESS INSURANCE		
			TOTAL SALES TAX		
PLEASE PAY THIS AMOUNT					

CUSTOMER #: 509623

291943

Porsche Centre Vancouver

688 Terminal Avenue
Vancouver, BC V6A 2M5
Telephone: (604) 736-7911
Fax: (604) 738-6511
Service Direct: (604) 730-2111
Service Toll Free: 1-855-950-7378 (SERV)
www.dilawri.ca

INVOICE

DUPLICATE 3
PAGE 3


BUS:		CELL:		SERVICE ADVISOR: 118 RAY OKUCHI				
COLOUR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
WHITE	96	PORSCHE GT2		WP0ZZZ99ZTS392104		29337/29355		T2104
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE
31DEC96 DD		01JAN1998	17:00 21APR17			163.00	CASH	24APR17

R.O. OPENED		READY	OPTIONS:
12:07 02FEB17		13:20 24APR17	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
2	999-113-418-40		RUBBER SEAL		7.30	6.20	12.40
1	999-201-365-01		ARTICULATED BUSH		14.69	12.49	12.49
2	999-270-070-01		OVAL-HEAD SCREW 6X14		7.30	6.20	12.40
1	931-102-111-02		GROOVED BALL BEARING		43.65	37.10	37.10
9	928-102-151-01		SOCKET SCREW 10X24		9.89	8.41	75.69
1	996-116-015-33		AS CLUTCH DISK		704.75	599.04	599.04
1	964-116-028-53		PRESSURE PLATE		875.71	744.35	744.35
PART# CHECK AT DISASSEMBLY							
9	999-510-015-01		PAN-HEAD SCREW 8X40		10.26	8.72	78.48
1	944-116-080-01		RELEASE BEARING 72MM		340.88	289.75	289.75
1	950-116-813-30		CLUTCH GUIDE TUBE		186.54	158.56	158.56
1	950-116-237-12		CLUTCH SLAVE CYL.		278.38	236.62	236.62
2	999-703-077-40		PLAST.PLUG		4.35	3.70	7.40
6	900-067-103-01		PAN-HEAD SCREW 8X45		3.75	3.19	19.14
3	900-067-103-01		PAN-HEAD SCREW 8X45		3.75	3.19	9.57
PCNA Ontario							
1	964-114-143-31		RING GEAR		356.75	303.24	303.24
4	999-084-613-02		LOCK NUT 6M		2.79	2.37	9.48
4000	MISC	DRIVELINE	DIFF				
4087 ISPC							(N/C)

PARTS: 3035.81 LABOR: 1385.50 OTHER: 0.00 TOTAL LINE B: 4421.31

29337
ROAD TEST,
CHECK TRANSMISSION SHIFTING OPERATION,
TRANSMISSION;
-NOISE FROM TRANSMISSION RELEASE BEARING AREA WHEN CLUTCH PEDAL IS
DEPRESSED,
-HARD TO SHIFT INTO FIRST GEAR AT TIMES WHEN VEHICLE IS STANDING
STILL,
-ON 2-1 DOWN SHIFT AT TIMES TRANSMISSION WILL GRIND GOING INTO
FIRST GEAR,
-CLUTCH JUTTERS ON ENGAGEMENT
-RECOMMEND TO CHECK TRANSMISSION OIL INSTALLED & DRAIN PLUG MAGNET
FOR METAL DEBRIS AS FIRST STEP IN REPAIRS,

WE HANDLE ALL ICBC REPAIRS	 PORSCHE	Monday to Friday 8:00 am - 5:30 pm	DESCRIPTION		TOTALS
			LABOUR AMOUNT		
ALL WORK PERFORMED BY OUR FACTORY TRAINED TECHNICIANS	<p>The personal information on this form and any personal information we presently have on file is collected, used and disclosed by us for the purpose of selling, leasing, financing, servicing, repairing, licensing and testing your vehicle, providing loaner vehicles, providing service reminders, obtaining insurance coverage for you, contacting you to provide you with information regarding products and services that may be of interest to you and providing any other products and services requested by you. By signing this form, you expressly consent and agree to the collection, use and disclosure as described above. If you do not consent, please discuss this with a service representative.</p>		PARTS AMOUNT		
			GAS		
			SUBLET AMOUNT		
			ENVIRONMENTAL LEVY / MISC.		
			TOTAL CHARGES		
			LESS INSURANCE		
			TOTAL SALES TAX		
			PLEASE PAY THIS AMOUNT		

CUSTOMER #: 509623

291943

Porsche Centre Vancouver

688 Terminal Avenue
Vancouver, BC V6A 2M5
Telephone: (604) 736-7911
Fax: (604) 738-6511
Service Direct: (604) 730-2111
Service Toll Free: 1-855-950-7378 (SERV)
www.dilawri.ca


INVOICE

DUPLICATE 3
PAGE 4

BUS:		CELL:		SERVICE ADVISOR: 118 RAY OKUCHI			
COLOUR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT	TAG
WHITE	96	PORSCHE GT2		WP0ZZZ99ZTS392104		29337/29355	T2104
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31DEC96 DD		01JAN1998	17:00 21APR17		163.00	CASH	24APR17
R.O. OPENED		READY		OPTIONS:			
12:07 02FEB17		13:20 24APR17					
LINE OPCODE TECH TYPE HOURS				LIST	NET	TOTAL	

-RE & RE TRANSMISSION UNDER PANEL,
-DRAIN TRANSMISSION OIL, SOME METAL DEBRIS ON DRAIN PLUG MAGNET,
-REFILL TRANSMISSION WITH SWEPCO 201 80W90 GEAR OIL,
-ROAD TEST & RE CHECK TRANSMISSION SHIFTING,
-TRANSMISSION STILL GRINDS INTO FIRST GEAR DURING 2-1 DOWN SHIFT,
-RECOMMEND TO CHECK TRANSMISSION SYNCHROS WHEN TRANSMISSION IS
REMOVED FOR CLUTCH RELEASE BEARING REPAIRS,
CUSTOMER DECLINED ANY INTERNAL TRANSMISSION REPAIRS,
CUSTOMER APPROVED THE FOLLOWING WORK,
RE & RE TRANSMISSION FROM VEHICLE,
FOUND VEHICLE IS EQUIPPED WITH TWIN PLATE RACE CLUTCH & IS THE
CAUSE OF RATTLING NOISE WHEN CLUTCH PEDAL IS DEPRESSED,
INSTALL FACTORY SINGLE MASS FLYWHEEL (SUPPLIED BY CUSTOMER),
INSTALL PILOT BEARING TO NEW SINGLE MASS FLYWHEEL,
INSTALL NEW CLUTCH, PRESSURE PLATE, RELEASE BEARING & CLUTCH SLAVE
CYLINDER,
BLEED CLUTCH HYDRAULICS,
ADJUST CRANKSHAFT POSITION SENSOR AIR GAP TO NEW FLYWHEEL SENSOR
TEETH,
ROAD TEST AFTER REPAIRS,
CLUTCH OPERATION IS MUCH SMOOTHER AFTER REPAIRS & NO MORE RATTLING
NOISES WHEN CLUTCH PEDAL IS DEPRESSED.

C Yearly Service - Turbo. Perform Mult-Point Inspection Report. \$650.00 + taxes.			
YEARLYT Yearly Service - Turbo. Perform Mult-Point Inspection Report. \$650.00 + taxes.			
4087 CPP		346.37	346.37
1 993-107-203-04 OIL FILTER	47.48	40.36	40.36
1 503 FI CLNER	18.06	15.35	15.35
4 ML235B WW FLUID BU	1.48	1.26	5.04
2 900-123-118-30 ALUM SEAL RING	3.51	2.98	5.96
2 999-707-316-40 RUBBER O-RING	9.14	7.77	15.54

WE HANDLE ALL ICBC REPAIRS		Monday to Friday 8:00 am - 5:30 pm	DESCRIPTION	TOTALS
			LABOUR AMOUNT	
ALL WORK PERFORMED BY OUR FACTORY TRAINED TECHNICIANS	PORSCHE	The personal information on this form and any personal information we presently have on file is collected, used and disclosed by us for the purpose of selling, leasing, financing, servicing, repairing, licensing and testing your vehicle, providing loaner vehicles, providing service reminders, obtaining insurance coverage for you, contacting you to provide you with information regarding products and services that may be of interest to you and providing any other products and services requested by you. By signing this form, you expressly consent and agree to the collection, use and disclosure as described above. If you do not consent, please discuss this with a service representative.	PARTS AMOUNT	
			GAS	
			SUBLET AMOUNT	
			ENVIRONMENTAL LEVY / MISC.	
			TOTAL CHARGES	
			LESS INSURANCE	
TOTAL SALES TAX				
			PLEASE PAY THIS AMOUNT	

CUSTOMER #: 509623

291943

Porsche Centre Vancouver

688 Terminal Avenue
Vancouver, BC V6A 2M5
Telephone: (604) 736-7911
Fax: (604) 738-6511
Service Direct: (604) 730-2111
Service Toll Free: 1-855-950-7378 (SERV)
www.dilawri.ca

INVOICE

DUPLICATE 3
PAGE 5



BUS:		CELL:		SERVICE ADVISOR: 118 RAY OKUCHI					
COLOUR	YEAR	MAKE/MODEL		VIN		LICENSE	MILEAGE IN/ OUT		TAG
WHITE	96	PORSCHE GT2		WP0ZZZ99ZTS392104			29337/29355		T2104
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE	
31DEC96 DD		01JAN1998	17:00 21APR17			163.00	CASH	24APR17	
R.O. OPENED		READY		OPTIONS:					

R.O. OPENED		READY		OPTIONS:		163.00	CASH	24APR17
12:07 02FEB17		13:20 24APR17						
LINE	OPCODE	TECH	TYPE	HOURS		LIST	NET	TOTAL
	10	15W50M	MOBIL1			15.41	13.10	131.00
	1	993-207-201-02	OIL FILTER			28.73	24.42	24.42
PARTS:	237.67	LABOR:	346.37	OTHER:	0.00	TOTAL LINE C:		584.04
29337								

PERFORMED YEARLY SERVICE, TURBO MODELS. REPLACED ENGINE OIL AND FILTER AND RESET VEHICLE SERVICE REMINDER. SCANNED ALL CONTROL UNITS FOR POSSIBLE FAULT ENTRIES. INSPECTED VEHICLE AS PER PORSCHE MAINTENANCE GUIDELINES FOR GIVEN MODEL YEAR. CHECKED AND ADJUSTED ALL LIGHTS, TIRE PRESSURES AND FLUID LEVELS.
BRAKE PAD MATERIAL REMAINING AT THE TIME OF INSPECTION: FRONT 9MM, REAR 11MM,
TIRE TREAD DEPTH REMAINING AT THE TIME OF INSPECTION: FRONT 9MM, REAR 9MM.

D Perform Porsche Multi-Point Inspection Report
INSP Perform Porsche Multi-Point Inspection Report
4087 ISPC
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE D: (N/C) 0.00
29337

PERFORM INSPECTION AS PER CHECK SHEET,
BODY EXTERIOR;
-L/F DOOR GLASS IS SCRATCHED & MAKES A SCRAPING NOISE WHEN GOING UP/DOWN, FOUND INCORRECT LENGTH SCREW WAS USED FOR ATTACHING INSIDE DOOR TRIM PANEL & SCREW SCRATCHED GLASS, RECOMMEND INSTALLING CORRECT SCREW & REPLACING DOOR GLASS IF SCRATCH BOTHERS CUSTOMER
BODY INTERIOR;
-GAS SMELL IN TRUNK, RECOMMEND REPLACING FUEL LEVEL SENSOR SEAL & RECHECK FOR FUEL SMELL
-R/F DOOR SWITCH RUBBER BOOT IS MISSING, RECOMMEND REPLACING
-R/F DOOR EXTERIOR HANDLE RUBBER SEAL IS MISSING, RECOMMEND REPLACING
ENGINE;
-OIL SWEAT FROM L/SIDE LOWER VALVE COVER

WE HANDLE ALL ICBC REPAIRS		Monday to Friday 8:00 am - 5:30 pm	DESCRIPTION		TOTALS
			LABOUR AMOUNT		
ALL WORK PERFORMED BY OUR FACTORY TRAINED TECHNICIANS			PARTS AMOUNT		
			GAS		
			SUBLET AMOUNT		
			ENVIRONMENTAL LEVY / MISC.		
			TOTAL CHARGES		
			LESS INSURANCE		
			TOTAL SALES TAX		
			PLEASE PAY THIS AMOUNT		

CUSTOMER #: 509623

291943

Porsche Centre Vancouver

688 Terminal Avenue
Vancouver, BC V6A 2M5
Telephone: (604) 736-7911
Fax: (604) 738-6511
Service Direct: (604) 730-2111
Service Toll Free: 1-855-950-7378 (SERV)
www.dilawri.ca

INVOICE

DUPLICATE 3
PAGE 6

BUS:		CELL:		SERVICE ADVISOR: 118 RAY OKUCHI			
COLOUR	YEAR	MAKE/MODEL	VIN		LICENSE	MILEAGE IN/ OUT	TAG
WHITE	96	PORSCHE GT2	WP0ZZZ99ZTS392104			29337/29355	T2104
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31DEC96 DD		01JAN1998	17:00 21APR17		163.00	CASH	24APR17

R.O. OPENED	READY	OPTIONS:
12:07 02FEB17	13:20 24APR17	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

-OIL LEAK FROM LEFT SIDE TURBO, RECOMMEND REPLACING DRAIN PLUG WASHER @ TURBO OIL RESERVOIR & RECHECK FOR OIL LEAKS
-OIL SWEAT AT RIGHT SIDE CYLINDER BASE GASKETS
-LEFT HEAT EXCHANGER IS DENTED
-RUBBER BOOT FROM FAN SHROUD TO AUX ENGINE COMPARTMENT FAN IS SPLIT, RECOMMEND REPLACING RUBBER BOOT
CLIMATE CONTROLS;
-FOUND THE FOLLOWING AC CONTROL UNIT FAULT CODE; -45 INSIDE SENSOR MOTOR, REQUIRES RE & RE OF AC CONTROL UNIT TO CHECK INTERIOR TEMP SENSOR FAN MOTOR OPERATION
TIRES;
-FRONT TREAD DEPTH 9MM, 2015 PRODUCTION DATE,
-REAR TREAD DEPTH 9MM, 2015 PRODUCTION DATE
-ALL 4 TIRES ARE NON "N" RATED,
BRAKES;
-FRONT BRAKE PADS HAVE 9MM,
-FRONT BRAKE DISCS 31.9MM (MIN 20.0MM),
-REAR BRAKE PADS HAVE 9MM LEFT,
-REAR BRAKE DISCS 28.0MM (MIN 26.0MM),
CHASSIS;
-STEERING WHEEL IS OFF CENTER TO THE RIGHT, RECOMMEND WHEEL ALIGNMENT
-NO STEERING RACK OIL LEAKS FOUND AT PRESENT

E WASH & VACUUM

103 WASH & VACUUM

4087 CPP

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE E: 0.00

F** REPLACE LT DOOR PANEL SCREW

8000 MISC.INTERIOR AND GLASS

4087 CPP

41.56 41.56

PARTS: 0.00 LABOR: 41.56 OTHER: 0.00 TOTAL LINE F: 41.56

29337

WE HANDLE ALL
ICBC
REPAIRS



PORSCHE

Monday
to
Friday
8:00 am - 5:30 pm

ALL WORK PERFORMED
BY OUR
FACTORY TRAINED
TECHNICIANS

The personal information on this form and any personal information we presently have on file is collected, used and disclosed by us for the purpose of selling, leasing, financing, servicing, repairing, licensing and testing your vehicle, providing loaner vehicles, providing service reminders, obtaining insurance coverage for you, contacting you to provide you with information regarding products and services that may be of interest to you and providing any other products and services requested by you. By signing this form, you expressly consent and agree to the collection, use and disclosure as described above. If you do not consent, please discuss this with a service representative.

DESCRIPTION	TOTALS
LABOUR AMOUNT	
PARTS AMOUNT	
GAS	
SUBLET AMOUNT	
ENVIRONMENTAL LEVY / MISC.	
TOTAL CHARGES	
LESS INSURANCE	
TOTAL SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER #: 509623

291943

Porsche Centre Vancouver

688 Terminal Avenue
Vancouver, BC V6A 2M5
Telephone: (604) 736-7911
Fax: (604) 738-6511
Service Direct: (604) 730-2111
Service Toll Free: 1-855-950-7378 (SERV)
www.dilawri.ca

INVOICE

DUPLICATE 3
PAGE 7

BUS:		CELL:		SERVICE ADVISOR: 118 RAY OKUCHI				
COLOUR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
WHITE	96	PORSCHE GT2		WP0ZZZ99ZTS392104		29337/29355		T2104
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
31DEC96 DD		01JAN1998	17:00 21APR17		163.00	CASH	24APR17	


R.O. OPENED	READY	OPTIONS:
12:07 02FEB17	13:20 24APR17	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
FOUND MOUNTING BRACKET FOR TOP DOOR PANEL TRIM ON L/F DOOR WAS BROKEN OFF & TOO LONG OF SCREW USED TO MOUNT TOP PART OF DOOR PANEL TO DOOR FRAME, INSTALL SHORTER SCREW AS TO NOT CONTACT WINDOW GLASS, REPLACE MISSING TRIM PLUG FOR BOTH TOP PORTION OF DOOR PANELS FOR L & R FRONT DOORS.							

G** REPLACE WIPER BLADE BUFFER							
9000 MISC EXTERIOR & PAINT							
4087 CPP							
1 993-628-239-01 RUBBER STOP							
1 999-703-396-01 BONDED RUBBER BUFFER							
PARTS:	54.88	LABOR:	0.00	OTHER:	0.00	TOTAL LINE G:	54.88
29337 INSTALL MISSING WIPER BLADE RUBBER BUFFER.							

H** REPAIR FUEL SMELL LEAK IN TRUNK							
1000 MISC ENGINE MAIN							
4087 CPP							
1 999-707-115-40 RUBBER O-RING							
PARTS:	9.20	LABOR:	138.55	OTHER:	0.00	TOTAL LINE H:	147.75
29337							
FOUND FUEL RESIDUE AROUND LEVEL SENSOR, RE & RE FUEL LEVEL SENSOR, REPLACE FUEL LEVEL SENSOR O-RING, FILL FUEL TANK & CHECK FOR LEAKS, NO FURTHER LEAKS FOUND AT PRESENT.							

I** REPLACE R/F DOOR SWITCH RUBBER							
9000 MISC EXTERIOR & PAINT							
4087 CPP							
1 901-615-616-20 RUBBER CAP							
PARTS:	7.00	LABOR:	27.71	OTHER:	0.00	TOTAL LINE I:	34.71
29337 REPLACE R/F DOOR SWITCH RUBBER BOOT.							

WE HANDLE ALL ICBC REPAIRS		Monday to Friday 8:00 am - 5:30 pm	DESCRIPTION	TOTALS
			LABOUR AMOUNT	
ALL WORK PERFORMED BY OUR FACTORY TRAINED TECHNICIANS	PORSCHE	The personal information on this form and any personal information we presently have on file is collected, used and disclosed by us for the purpose of selling, leasing, financing, servicing, repairing, licensing and testing your vehicle, providing loaner vehicles, providing service reminders, obtaining insurance coverage for you, contacting you to provide you with information regarding products and services that may be of interest to you and providing any other products and services requested by you. By signing this form, you expressly consent and agree to the collection, use and disclosure as described above. If you do not consent, please discuss this with a service representative.	PARTS AMOUNT	
			GAS	
			SUBLET AMOUNT	
			ENVIRONMENTAL LEVY / MISC.	
			TOTAL CHARGES	
			LESS INSURANCE	
			TOTAL SALES TAX	
PLEASE PAY THIS AMOUNT				

CUSTOMER #: 509623

291943

Porsche Centre Vancouver

688 Terminal Avenue
Vancouver, BC V6A 2M5
Telephone: (604) 736-7911
Fax: (604) 738-6511
Service Direct: (604) 730-2111
Service Toll Free: 1-855-950-7378 (SERV)
www.dilawri.ca

INVOICE

DUPLICATE 3
PAGE 8

BUS:		CELL:		SERVICE ADVISOR: 118 RAY OKUCHI					
COLOUR	YEAR	MAKE/MODEL		VIN		LICENSE	MILEAGE IN/ OUT		TAG
WHITE	96	PORSCHE GT2		WP0ZZZ99ZTS392104			29337/29355		T2104
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE	
31DEC96 DD		01JAN1998	17:00 21APR17			163.00	CASH	24APR17	
R.O. OPENED		READY		OPTIONS:					
12:07 02FEB17		13:20 24APR17							

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

J** REPLACE R/F DOOR EXTERIOR RUBBER
9000 MISC EXTERIOR & PAINT



4087 CPP 207.82 207.82
PARTS: 0.00 LABOR: 207.82 OTHER: 0.00 TOTAL LINE J: 207.82
29337

R/F DOOR EXTERIOR HANDLE RUBBER SEALS ARE WORN,
RE & RE R/F DOOR PANEL,
RE & RE R/F DOOR INNER VAPOR LINER,
RE & RE R/F DOOR EXTERIOR HANDLE,
INSTALL CUSTOMER SUPPLIED RUBBER SEALS FOR R/F DOOR EXTERIOR
HANDLE,
CUSTOMER ALSO SUPPLIED A SECOND SET OF DOOR HANDLE SEALS,
EXTRA SEALS ARE IN REAR OF CENTER CONSOLE.

K** OIL LEAK FROM LEFT SIDE TURBO
1000 MISC ENGINE MAIN

4087 CPP 235.53 235.53
PARTS: 0.00 LABOR: 235.53 OTHER: 0.00 TOTAL LINE K: 235.53
29337

RE & RE DRAIN PLUG FROM LEFT TURBO OIL RESERVOIR,
APPLY THREAD SEALANT & REPLACE DRAIN PLUG WASHER,
WASH OIL RESIDUE FROM TURBO,
RUN ENGINE & RE CHECK FOR OIL LEAKS,
FOUND OIL LEAKING FROM HOSE BETWEEN LEFT TURBO & INTER COOLER,
RECOMMEND REPLACING HOSES & CLAMPS,
AS PER CUSTOMER REQUEST,
RE & RE HOSE BETWEEN INTER COOLER & LEFT TURBO,
CLEAN SEALING SURFACE AT LEFT TURBO,
REINSTALL HOSE & TIGHTEN HOSE CLAMPS TO SPEC,
WASH OIL RESIDUE FROM ENGINE,
ROAD TEST & RECHECK FOR OIL LEAKS,
NO FURTHER OIL LEAKS FOUND FROM HOSE BETWEEN INTER COOLER & LEFT
SIDE TURBO.

WE HANDLE ALL ICBC REPAIRS		Monday to Friday 8:00 am - 5:30 pm	DESCRIPTION	TOTALS
			LABOUR AMOUNT	
ALL WORK PERFORMED BY OUR FACTORY TRAINED TECHNICIANS		The personal information on this form and any personal information we presently have on file is collected, used and disclosed by us for the purpose of selling, leasing, financing, servicing, repairing, licensing and testing your vehicle, providing loaner vehicles, providing service reminders, obtaining insurance coverage for you, contacting you to provide you with information regarding products and services that may be of interest to you and providing any other products and services requested by you. By signing this form, you expressly consent and agree to the collection, use and disclosure as described above. If you do not consent, please discuss this with a service representative.	PARTS AMOUNT	
			GAS	
			SUBLET AMOUNT	
			ENVIRONMENTAL LEVY / MISC.	
			TOTAL CHARGES	
			LESS INSURANCE	
			TOTAL SALES TAX	
			PLEASE PAY THIS AMOUNT	

CUSTOMER #: 509623

291943

Porsche Centre Vancouver

688 Terminal Avenue
Vancouver, BC V6A 2M5
Telephone: (604) 736-7911
Fax: (604) 738-6511
Service Direct: (604) 730-2111
Service Toll Free: 1-855-950-7378 (SERV)
www.dilawri.ca

INVOICE

DUPLICATE 3
PAGE 9


BUS:		CELL:		SERVICE ADVISOR: 118 RAY OKUCHI			
COLOUR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT	TAG
WHITE	96	PORSCHE GT2		WP0ZZZ99ZTS392104		29337/29355	T2104
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31DEC96 DD		01JAN1998	17:00 21APR17		163.00	CASH	24APR17
R.O. OPENED		READY	OPTIONS:				

12:07 02FEB17	13:20 24APR17						
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
L**	REPLACE FAN SHROUD BOOT						
	1000 MISC ENGINE MAIN						
	4087 CPP					0.00	0.00
	1 993-106-403-00 ENGINE AIR DUCT					72.53	61.65
PARTS:	61.65	LABOR:	0.00	OTHER:	0.00	TOTAL LINE L:	61.65
29337 REPLACE ENGINE COOLING FAN SHROUD RUBBER BOOT DURING REPAIRS							
FOR LINE "A".							

M**	AC CONTROL UNIT FAULT						
	8000 MISC.INTERIOR AND GLASS						
	4087 CPP					319.60	319.60
	1 964-659-148-00 FAN W/SENSOR					477.17	405.59
PARTS:	405.59	LABOR:	319.60	OTHER:	0.00	TOTAL LINE M:	725.19
29337							

RE & RE AC CONTROL UNIT,
CHECK INTERIOR TEMP SENSOR BLOWER MOTOR,
FOUND BLOWER MOTOR WAS UNPLUGGED,
RECONNECT ELECTRICAL CONNECTOR FOR BLOWER MOTOR,
CLEAR FAULT CODES & RE CHECK BLOWER MOTOR OPERATION,
FAULT DID NOT RETURN,
FOUND AT TIMES DURING OPERATION BLOWER MOTOR BEARINGS ARE NOISY &
FAN MAKES A SQUEAKING NOISE,
RECOMMEND REPLACING INTERIOR TEMP SENSOR BLOWER MOTOR,
REPLACE INTERIOR TEMP SENSOR BLOWER MOTOR @ REAR OF CLIMATE CONTROL
UNIT,
CHECK OPERATION AFTER REPAIRS,
CHECK FOR FAULT CODES AFTER REPAIRS,
NO FURTHER FAULTS FOUND AFTER REPAIRS.

N** Porsche Four Wheel Alignment. \$375.00+tax. If vehicle is equipped
with ACC (Automatic Cruise Control) there will additional cost
to calibrate system - add \$238.50+tax.
5004P Porsche Four Wheel Alignment. \$375.00+tax.
If vehicle is equipped with ACC (Automatic

WE HANDLE ALL ICBC REPAIRS		Monday to Friday 8:00 am - 5:30 pm	DESCRIPTION		TOTALS
			LABOUR AMOUNT		
ALL WORK PERFORMED BY OUR FACTORY TRAINED TECHNICIANS	PORSCHE	<p>The personal information on this form and any personal information we presently have on file is collected, used and disclosed by us for the purpose of selling, leasing, financing, servicing, repairing, licensing and testing your vehicle, providing loaner vehicles, providing service reminders, obtaining insurance coverage for you, contacting you to provide you with information regarding products and services that may be of interest to you and providing any other products and services requested by you. By signing this form, you expressly consent and agree to the collection, use and disclosure as described above. If you do not consent, please discuss this with a service representative.</p>	PARTS AMOUNT		
			GAS		
			SUBLET AMOUNT		
			ENVIRONMENTAL LEVY / MISC.		
			TOTAL CHARGES		
			LESS INSURANCE		
			TOTAL SALES TAX		
PLEASE PAY THIS AMOUNT					

CUSTOMER #: 509623

291943

Porsche Centre Vancouver

688 Terminal Avenue
Vancouver, BC V6A 2M5
Telephone: (604) 736-7911
Fax: (604) 738-6511
Service Direct: (604) 730-2111
Service Toll Free: 1-855-950-7378 (SERV)
www.dilawri.ca

INVOICE

DUPLICATE 3
PAGE 10

BUS:		CELL:		SERVICE ADVISOR: 118 RAY OKUCHI			
COLOUR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT	TAG
WHITE	96	PORSCHE GT2		WP0ZZZ99ZTS392104		29337/29355	T2104
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31DEC96 DD		01JAN1998	17:00 21APR17		163.00	CASH	24APR17
R.O. OPENED		READY	OPTIONS:				
12:07 02FEB17		13:20 24APR17					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

Cruise Control) there will additional cost
to calibrate system - add \$238.50+tax.

4087 CPP 318.75 318.75

PARTS: 0.00 LABOR: 318.75 OTHER: 0.00 TOTAL LINE N: 318.75

29355
CHECK & ADJUST TIRE PRESSURES,
ROAD TEST,
PLACE VEHICLES ON WEIGH SCALES & CHECK CORNER BALANCING,
L/F 243KG, R/F 262KG, L/R 417KG, R/R 407KG,
FRONT WEIGHT BIAS 38%, REAR WEIGHT BIAS 62%,
ALL CORNER BALANCE MEASUREMENTS ARE WITHIN SPEC,
MOUNT ALIGNMENT HEADS,
PERFORM CASTER SWEEP,
RE & RE ENGINE & TRANSMISSION UNDER PANELS,
CHECK & ADJUST REAR TOE & CAMBER,
CHECK & ADJUST REAR KINEMATIC TOE,
L/R KINEMATIC TOE SETTING AFTER ADJUSTMENTS 1.5,
R/R KINEMATIC TO SETTING AFTER ADJUSTMENTS 1.5,
ALL WITHIN SPEC,
PERFORM CASTER SWEEP,
CHECK & ADJUST FRONT CAMBER, CASTER & TOE,
PERFORM CASTER SWEEP,
NO 993 GT2 ALIGNMENTS SPECS AVAILABLE,
VEHICLE ALIGNED TO ROW 993 TURBO SPECS,
FRONT CAMBER SETTINGS NOT WITHIN SPEC BUT EVEN BETWEEN LEFT &
RIGHT,
ROAD TEST AFTER REPAIRS.


O** PARTS

10600 COMMENT

4087 IPPC (N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE O: 0.00

29337 TIME SPENT TO SOURCE & DETERMINE CORRECT PARTS FOR VEHICLE.

WE HANDLE ALL ICBC REPAIRS	 PORSCHE <small>The personal information on this form and any personal information we presently have on file is collected, used and disclosed by us for the purpose of selling, leasing, financing, servicing, repairing, licensing and testing your vehicle, providing loaner vehicles, providing service reminders, obtaining insurance coverage for you, contacting you to provide you with information regarding products and services that may be of interest to you and providing any other products and services requested by you. By signing this form, you expressly consent and agree to the collection, use and disclosure as described above. If you do not consent, please discuss this with a service representative.</small>	Monday to Friday 8:00 am - 5:30 pm	DESCRIPTION		TOTALS
			LABOUR AMOUNT		
PARTS AMOUNT					
GAS					
SUBLET AMOUNT					
ENVIRONMENTAL LEVY / MISC.					
TOTAL CHARGES					
LESS INSURANCE					
TOTAL SALES TAX					
PLEASE PAY THIS AMOUNT					
ALL WORK PERFORMED BY OUR FACTORY TRAINED TECHNICIANS					

CUSTOMER #: 509623

291943

Porsche Centre Vancouver

688 Terminal Avenue
Vancouver, BC V6A 2M5
Telephone: (604) 736-7911
Fax: (604) 738-6511
Service Direct: (604) 730-2111
Service Toll Free: 1-855-950-7378 (SERV)
www.dilawri.ca

INVOICE

DUPLICATE 3
PAGE 11

BUS:		CELL:		SERVICE ADVISOR: 118 RAY OKUCHI					
COLOUR	YEAR	MAKE/MODEL		VIN		LICENSE	MILEAGE IN/ OUT		TAG
WHITE	96	PORSCHE GT2		WP0ZZZ99ZTS392104			29337/29355		T2104
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE	
31DEC96 DD		01JAN1998	17:00 21APR17			163.00	CASH	24APR17	
R.O. OPENED		READY		OPTIONS:					


R.O. OPENED	READY	OPTIONS:						
12:07 02FEB17	13:20 24APR17							
LINE OPCODE TECH TYPE HOURS					LIST	NET	TOTAL	
P** POWER STEERING FLUID LEAK								
1000 MISC ENGINE MAIN								
4087 CPP						0.00	0.00	
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE P:	0.00	

29337
SEE LINE "A" STORY,
RE TIGHTENED BOLTS FOR STEERING PUMP BODY,
NO FURTHER LEAKS FOUND AFTER REPAIRS.

SHOP SUPPLIES &/OR ENVIRONMENTAL CHARGES 54.05

IF YOU ARE NOT 100% SATISFIED WITH YOUR VISIT
TO OUR SERVICE DEPARTMENT PLEASE LET US KNOW.
THE MANUFACTURER MAY ALSO CONTACT YOU AND
ANYTHING LESS THAN A 10/10 IS A FAIL FOR US.
THANK YOU FROM YOUR SERVICE TEAM
***** INITIAL HERE: *****

GST#812014462 (#: 812014462) 398.70
PST#1011-7530 558.19

WE HANDLE ALL ICBC REPAIRS	 PORSCHE	Monday to Friday 8:00 am - 5:30 pm	DESCRIPTION	TOTALS
			LABOUR AMOUNT	4102.08
ALL WORK PERFORMED BY OUR FACTORY TRAINED TECHNICIANS	<small>The personal information on this form and any personal information we presently have on file is collected, used and disclosed by us for the purpose of selling, leasing, financing, servicing, repairing, licensing and testing your vehicle, providing loaner vehicles, providing service reminders, obtaining insurance coverage for you, contacting you to provide you with information regarding products and services that may be of interest to you and providing any other products and services requested by you. By signing this form, you expressly consent and agree to the collection, use and disclosure as described above. If you do not consent, please discuss this with a service representative.</small>		PARTS AMOUNT	3818.00
			GAS	0.00
			SUBLET AMOUNT	0.00
			ENVIRONMENTAL LEVY / MISC.	54.05
			TOTAL CHARGES	7974.13
			LESS INSURANCE	0.00
			TOTAL SALES TAX	956.89
			PLEASE PAY THIS AMOUNT	8931.02



The Porsche Multi-Point Inspection Report

The Porsche Multi-Point Inspection Report is a series of thorough vehicle "health checks" performed by factory-trained Porsche technicians. It is designed to keep your Porsche operating in top condition and to prevent chances of being inconvenienced on the road. If additional service is recommended on any inspection, your Porsche Service Advisor will be happy to speak with you about your options.

Raymond Poon

Customer Name

291943 T2104

RO/Tag

29337

Mileage

1996

Year/Model

WP0ZZZ99ZTS392104

VIN

Engine Size

04/24/2017

Date

Checked and Okay at this Time

May Require Future Attention*

Requires Immediate Attention

Check Fluid Levels and Fill

OK FILL

OK FILL



Engine Oil



Brake Reservoir



Windshield Washer



Headlamp Washer



Power Steering



Coolant Recovery Reservoir



Transmission (if equipped w/ dipstick)

Check Following Systems / Components



Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps



Visually inspect headlamp alignment



Windshield washer spray, wiper operation and wiper blades



Windshield cracks and/or chips



Heating, ventilation and air conditioning check



Engine air cleaner filter



Oil and/or fluid leaks



Constant velocity (CV) drive axle boots (if equipped)



Exhaust system (leaks, damage, loose parts)



Steering and steering linkages



Shocks/struts, air suspension and other suspension components for leaks and/or damage



Brake system (including lines, hoses and parking brake)



Engine cooling system, hoses and clamps



Radiator, heater and air conditioning hoses for leaks / damage



Accessory drive belt(s)



Clutch operation (if equipped)



State inspection due (if applicable) _____ / _____ / _____
Month Day Year



Your last completed maintenance _____ : _____ / _____
Mileage Month Year



Your next factory scheduled maintenance is due at _____ : _____ / _____
Mileage Month Year

This Courtesy Inspection Completed By Your Porsche Service Team

Service Advisor: Ray Okuchi

Technician: Sean Robinson

Customer Signature: _____

Check Battery



Good



Recharge



Bad


Check Brakes

Measure Front / Rear Brake Linings

RF



RR

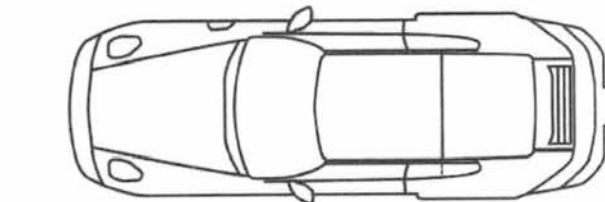

LF



LR



Over 5mm or 7/32"

3 to 5mm or 4/32" to 7/32"

Less than 2mm or 3/32"

Brake Measurements Not Taken This Service Visit ☐

Check Tires

LF



7/32" or Greater



4/32" to 6/32"



3/32" or Less



7/32" or Greater



4/32" to 6/32"



3/32" or Less

LR



7/32" or Greater



4/32" to 6/32"



3/32" or Less



7/32" or Greater



4/32" to 6/32"



3/32" or Less

RF



7/32" or Greater



4/32" to 6/32"



3/32" or Less

RR



7/32" or Greater



4/32" to 6/32"



3/32" or Less

LF



7/32" or Greater



4/32" to 6/32"



3/32" or Less

LR



7/32" or Greater



4/32" to 6/32"



3/32" or Less

RF



7/32" or Greater

4/32" to 6/32"

3/32" or Less

RR

7/32" or Greater

4/32" to 6/32"

3/32" or Less

LF

7/32" or Greater

4/32" to 6/32"

3/32" or Less

LR

7/32" or Greater

4/32" to 6/32"

3/32" or Less

RF

7/32" or Greater

4/32" to 6/32"

3/32" or Less

RR

7/32" or Greater

4/32" to 6/32"

3/32" or Less

LF

7/32" or Greater

4/32" to 6/32"

3/32" or Less

LR

7/32" or Greater

4/32" to 6/32"

3/32" or Less

RF

7/32" or Greater

4/32" to 6/32"

3/32" or Less

RR

7/32" or Greater

4/32" to 6/32"

3/32" or Less

LF

7/32" or Greater

4/32" to 6/32"

3/32" or Less

LR

7/32" or Greater

4/32" to 6/32"

3/32" or Less

RF

7/32" or Greater

4/32" to 6/32"

3/32" or Less

RR

7/32" or Greater

4/32" to 6/32"

3/32" or Less

LF

7/32" or Greater

4/32" to 6/32"

3/32" or Less

LR

7/32" or Greater

4/32" to 6/32"

3/32" or Less

RF

7/32" or Greater

4/32" to 6/32"

3/32" or Less

RR

7/32" or Greater

4/32" to 6/32"

3/32" or Less

LF



PORSCHE

Comments:

PANEL & SCREW SCRATCHED GLASS, RECOMMEND INSTALLING CORRECT SCREW & REPLACING DOOR GLASS IF SCRATCH BOTHERS CUSTOMER

BODY INTERIOR;-GAS SMELL IN TRUNK, RECOMMEND REPLACING FUEL LEVEL SENSOR SEAL & RECHECK FOR FUEL SMELL-R/F DOOR SWITCH RUBBER BOOT IS MISSING, RECOMMEND REPLACING R/F DOOR EXTERIOR HANDLE RUBBER SEAL IS MISSING, RECOMMEND REPLACING

ENGINE;-OIL SWEAT FROM L/SIDE LOWER VALVE COVER-OIL LEAK FROM LEFT SIDE TURBO, RECOMMEND REPLACING DRAIN PLUG WASHER @ TURBO OIL RESERVOIR & RECHECK FOR OIL LEAKS-OIL SWEAT AT RIGHT SIDE CYLINDER BASE GASKETS-LEFT HEAT EXCHANGER IS DENTED-RUBBER BOOT FROM FAN SHROUD TO AUX ENGINE COMPARTMENT FAN IS SPLIT, RECOMMEND REPLACING RUBBER BOOT

CLIMATE CONTROLS;-FOUND THE FOLLOWING AC CONTROL UNIT FAULT CODE; -45 INSIDE SENSOR MOTOR, REQUIRES RE & RE OF AC CONTROL UNIT TO CHECK INTERIOR TEMP SENSOR FAN MOTOR OPERATION

TIRES;-FRONT TREAD DEPTH 9MM, 2015 PRODUCTION DATE,-REAR TREAD DEPTH 9MM, 2015 PRODUCTION DATE-ALL 4 TIRES ARE NON "N" RATED,

BRAKES;-FRONT BRAKE PADS HAVE 9MM, -FRONT BRAKE DISCS 31.9MM (MIN 20.0MM),-REAR BRAKE PADS HAVE 9MM LEFT,-REAR BRAKE DISCS 28.0MM (MIN 26.0MM),

CHASSIS;-STEERING WHEEL IS OFF CENTER TO THE RIGHT, RECOMMEND WHEEL ALIGNMENT-NO STEERING RACK OIL LEAKS FOUND AT PRESENT

Left Front Brake Linings: 9MM

Right Front Brake Linings: 9MM

Left Rear Brake Linings: 11MM

Right Rear Brake Linings: 11MM

Left Front Tread Depth: 9MM

Right Front Tread Depth: 9MM

Left Rear Tread Depth: 9MM

Right Rear Tread Depth: 9MM

Juan's Auto Service Ltd.

8580 River Road

Richmond, BC

V6X 1Y4

Tel.#: (604) 241-2848 FAX: (604) 241-2949

CUSTOMER

VEHICLE

INVOICE ADMIN.

0 Porsche 911

Plate : GT2

ODO : 0 Km

V.I.N.:

Unit #:

Engine:

INV # : 14723

Date : 09/18/2018

Time :

PO # :

REG # : 794206326BC0001

Tech. : JUAN/JUAN

C#:

Qty	Hrs.	Description	Parts Ea.	Tot.Parts	Labour	Tx	Total	C
7.00		Valve cover screw	3.00	21.00		B	21.00	
1.00		Wrightwood VC gasket set	179.54	179.54		B	179.54	
31.00		Valve cover screw	3.00	93.00		B	93.00	
22.00		exhaust and turbo nuts	8.39	184.58		B	184.58	
6.00		exhaust nuts	8.32	49.92		B	49.92	
2.00		exhaust ring	43.23	86.46		B	86.46	
2.00		exhaust ring	93.81	187.62		B	187.62	
6.00		Exhaust seal ring	27.64	165.84		B	165.84	
4.00		stud m8x26	26.62	106.48		B	106.48	
1.00		freight	52.94	52.94		B	52.94	
	5.00	removed exhaust,etc.				B		
1.00		Exhaust manifold repaired	192.00	192.00		B	192.00	
1.00		Manifold sandblast inner	50.00	50.00		B	50.00	
		area for welding				B		
	6.00	replaced valve covers, cleaned				B		
		area, removed turbo to				B		
		intercooler hose, replaced.				B		
	4.00	assembled all exhaust, turbo,				B		
		and oxygen sensors.				B		
1.00		intercooler to turbo hose	390.17	390.17		B	390.17	
1.00		freight	45.00	45.00		B	45.00	
		Shop Supplies			32.00	B	32.00	

WO# 17052

Copyright 2018 Autogence Inc. - LANKAR 10.0.2

Follow us on social!

Facebook: Juan's Auto Service

Instagram: juans.autoservice

Website: www.juans.ca

Email: service@juans.ca

I hereby authorize the above work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Sub Tot.	1,804.55	32.00	1,836.55
GST			91.83
PST			128.56
Deductible			0.00
Total			2,056.94

Page

1 of 2

Juan's Auto Service Ltd.

8580 River Road

Richmond, BC

V6X 1Y4

Tel.#: (604) 241-2848 FAX: (604) 241-2949

CUSTOMER			VEHICLE			INVOICE ADMIN		
C#			0 Porsche 911			INV # : 14723		
Qty			Plate : GT2			Date : 09/18/2018		
Hrs.			ODO : 0			Time :		
Description			V.I.N.:			PO # :		
			Unit #:			REG # : 794206326BC0001		
			Engine:			Tech. : JUAN/JUAN		
			</					