













Display CARFAX in online listings: ☐

 <b>Vehicle History Report™</b> <span>US \$44.99</span>	
VIN: ZHWBC77S58LA03237   This CARFAX Report Provided by: <b>Broad Arrow Group</b>	 No accidents or damage reported to CARFAX
	 <b>7</b> Detailed records available
	 <b>286</b> Last reported odometer reading


This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 7/18/23 at 9:28:51 AM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.

 <b>Title History</b> CARFAX guarantees the information in this section		Summary
<b>Damage Brands</b> Salvage   Junk   Rebuilt   Fire   Flood   Hail   Lemon		 <b>Guaranteed</b> No Problem
<b>Odometer Brands</b> Not Actual Mileage   Exceeds Mechanical Limits		 <b>Guaranteed</b> No Problem
 <b>GUARANTEED</b> - None of these major title problems were reported by a state Department of Motor Vehicles (DMV). If you find that any of these title problems were reported by a DMV and not included in this report, CARFAX will buy this vehicle back. <a href="#">View Terms</a>   <a href="#">View Certificate</a>		

 <b>Additional History</b> Not all accidents / issues are reported to CARFAX		Summary
<b>Total Loss</b> No total loss reported to CARFAX.		 No Issues Reported
<b>Structural Damage</b> No structural damage reported to CARFAX.		 No Issues Reported
<b>Airbag Deployment</b> No airbag deployment reported to CARFAX.		 No Issues Reported
<b>Odometer Check</b> No indication of an odometer rollback.		 No Issues Indicated

**Accident / Damage**

No accidents or damage reported to CARFAX.

 No Issues  
Reported
**Manufacturer Recall**

Check with an authorized dealer for any open recalls.

**Ask Your Dealer****Detailed History**

Date	Mileage	Source	Comments
11/02/2021		Vehicle Importer	<b>Vehicle exported and imported to British Columbia</b> - Vehicle may not comply with Canada Motor Vehicle Safety Standards
08/25/2022		British Columbia Motor Vehicle Dept. Kelowna, BC	<b>Registration issued or renewed</b> - Vehicle color noted as Gray
08/30/2022		Ontario Ministry of Transportation	<b>Registration issued or renewed</b> - Passed safety inspection - Vehicle previously registered in British Columbia - Vehicle color noted as Gray
10/04/2022	286	Ontario Ministry of Transportation Southwestern Ontario	<b>Passed Ontario safety standards inspection</b> - Registration issued or renewed - New owner reported - Registered as personal vehicle - Vehicle color noted as Gray - Odometer reported as 460 kilometers
02/16/2023		Ontario Service Facility	<b>Mechanical issue reported</b> - Vehicle towed
03/03/2023		Montana Motor Vehicle Dept.	<b>Vehicle purchase reported</b>
03/06/2023		Montana Motor Vehicle Dept. Helena, MT Title #AA6475471	<b>Title issued or updated</b> - Title or registration issued - New owner reported - Vehicle color noted as Gray

Have Questions? Consumers, please visit our Help Center at [www.carfax.com](http://www.carfax.com). Dealers or Subscribers, please visit our Help Center at [www.carfaxonline.com](http://www.carfaxonline.com).

**Glossary****New Owner Reported**

When a vehicle is sold to a new owner, the Title must be transferred to the new owner(s) at a Department of Motor Vehicles.

**Ownership History**

CARFAX defines an owner as an individual or business that possesses and uses a vehicle. Not all title transactions represent changes in ownership. To provide estimated number of owners, CARFAX proprietary technology analyzes all the events in a vehicle history. Estimated ownership is available for vehicles manufactured after 1991 and titled solely in the US including Puerto Rico. Dealers sometimes opt to take ownership of a vehicle and are required to in the following states: Maine, Massachusetts, New Jersey, Ohio, Oklahoma, Pennsylvania and South Dakota. Please consider this as you review a vehicle's estimated ownership history.

**Title Issued**

A state issues a title to provide a vehicle owner with proof of ownership. Each title has a unique number. Each title or registration record on a CARFAX report does not necessarily indicate a change in ownership. In Canada, a registration and bill of sale are used as proof of ownership.

**Follow Us:**[facebook.com/CARFAX](https://facebook.com/CARFAX)[@CARFAXinc](https://twitter.com/CARFAXinc)**About CARFAX**

CARFAX DEPENDS ON ITS SOURCES FOR THE ACCURACY AND RELIABILITY OF ITS INFORMATION. THEREFORE, NO RESPONSIBILITY IS ASSUMED BY CARFAX OR ITS AGENTS FOR ERRORS OR OMISSIONS IN THIS REPORT. CARFAX FURTHER EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.

© 2023 CARFAX, Inc., part of S&P Global. All rights reserved.  
7/18/23 9:28:51 AM (CDT)

**I have reviewed and received a copy of the CARFAX Vehicle History Report for this 0 vehicle (VIN: ZHWBC77S58LA03237), which is based on information supplied to CARFAX and available as of 7/18/23 at 10:28 AM (EDT).**

---

**Customer Signature**

---

**Date**

---

**Dealer Signature**

---

**Date**

# Experian AutoCheck Report

Report run: 08/16/2023 12:42:49 EDT

## 2008 Lamborghini

VIN: ZHWBC77S58LA03237

Class:

Country of Assembly: Italy

Vehicle Use: Personal

## AutoCheck Score

AutoCheck Score Not Available

## Vehicle History at a Glance



State Title Brand



Clean



Auction Brand / Issues



No Issue



Accident / Damage

No Accidents or Damage Reported



No Issue



Open Recall Check

Recall Information not received from manufacturer



Not Available



Insurance Loss / Transfer



No Issue



Odometer Check



No Issue



Certified Pre-Owned



No CPO Info Available



Service / Repair



No Issue



Additional History



No Issues Reported




This vehicle is eligible for Buyback Protection

Due to the vehicle's history showing no reported major state title brands. [Terms & Conditions](#)

[Learn More](#)



Accident & Damage

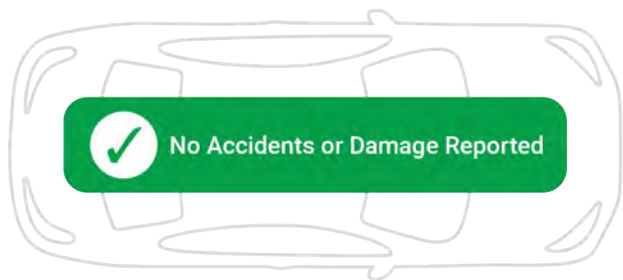

### Your Vehicle Checks Out

AutoCheck has not received any accident or damage-related events from government sources, independent agencies, or auction sources. Not all damage-related events are reported to AutoCheck. It is recommended to have pre-owned vehicles inspected by a third-party prior to purchase.



Airbag  
Deployed



Structural  
Damage



Overturned



No Damage



## Odometer Check



### Your Vehicle Checks Out

No odometer brands, rollbacks, rollover or tampering has been reported to AutoCheck from state Division of Motor Vehicles (DMV) or auction sources. AutoCheck also examined the sequence of reported odometer readings to determine if there are any potential discrepancies.



### State Title Odometer Check

No issues reported



### Auction Odometer Check

No issues reported



### Odometer Calculation Check

No issues reported



## Detailed Vehicle History

Below are the historical events for this vehicle listed in chronological order.

**Vehicle:** 2008 Lamborghini (ZHWBC77S58LA03237) **Report Run Date:** 08/16/2023 12:42:49 EDT

### All Reported Events

Event Date	Location	Odometer	Data Source	Details
08/28/2022	KELOWNA, BC		Motor Vehicle Dept.	Canadian Renewal
10/31/2022	ON		Motor Vehicle Dept.	Canadian Renewal

Event Date	Location	Odometer	Data Source	Details
02/05/2023	KELOWNA, BC		Motor Vehicle Dept.	Canadian Renewal
03/01/2023	HELENA, MT		Motor Vehicle Dept.	Registration Event/Renewal
03/06/2023	HELENA, MT		Motor Vehicle Dept.	Title(Title #:AA6475471)
03/17/2023	HELENA, MT		Motor Vehicle Dept.	Title(Title #:AA6475471)
07/31/2023	ON		Motor Vehicle Dept.	Canadian Renewal

**AutoCheck Terms and Conditions**

This report, and any reliance upon it, is subject to **AutoCheck Terms and Conditions**. If you obtained the report from a lender/dealer, the lender/dealer has been provided with these Terms and Conditions and can share them with you. These AutoCheck Terms and Conditions are also available at any time at [www.autocheck.com/terms](http://www.autocheck.com/terms) or by writing to Experian: Experian Automotive C/O AutoCheck Customer Service 955 American Lane Schaumburg, IL 60173.

**Buyback Protection Terms and Conditions**

This vehicle (ZHWBC77S58LA03237) qualifies for **AutoCheck Buyback Protection**. If you obtained the report from a dealer, the dealer has been provided with the terms and can share them with you. These Buyback Protection Terms and Conditions are also available to you at any time at [www.autocheck.com/bbpterm](http://www.autocheck.com/bbpterm)s or by writing to Experian: Experian Automotive C/O AutoCheckCustomer Service 955 American Lane Schaumburg, IL 60173.

**About AutoCheck**

AutoCheck vehicle history reports by Experian Automotive is the leading vehicle history reporting service. With expert data handling, the Experian Automotive database houses over 4 billion records on a half a billion vehicles. Every AutoCheck vehicle history report will give you confidence when buying or selling your next used vehicle, with superior customer service every step of the way.

**Patent Notice**

Certain aspects of this vehicle history report may be covered by U.S. Patent 8,005,759.





# LAMBORGHINI BEVERLY HILLS

11401 W. Pico Blvd. Los Angeles, Ca. 90064

Customer Pay Invoice

**\$12,764.80**

RO# : 213553 | Tag# : 9422

Check-in: Thu Feb 23, 2023 | 6:12 AM

Ready for Pickup: Thu Mar 16, 2023 | 8:53 AM

Promise Time: Tue Feb 28, 2023 | 5:00 PM

## Customer

### WIRES ONLY

(323) 383-6040

rd@sendthewire.com

2134 S SEPULVEDA BLVD

LOS ANGELES, CA 90025

## Pickup-Customer

Same as Customer

## Billing-Customer

Same as Customer

## Vehicle

2008 Lamborghini

Reventon

ZHWBC77S58LA03237

338 Mi In / 345 Mi Out

## Service Advisor

Anthony Matassa

A.	CONCERN	CUSTOMER REPORTS VEHICLE WILL NOT CRANK TO START AFTER PARKING. RECENT BATTERY REPLACEMENT PERFORMED- PLEASE CHECK AND REPORT	Customer Pay	\$0.00
----	---------	---	--------------	--------

Job added by Anthony Matassa on Thu Feb 23, 2023 | 6:12 AM

CONCERN --- Labor \$0.00

1. CONFIRMED CUSTOMER CONCERN, CHARGED VEHICLE BATTERY AND PERFORMED BATTERY TEST, BATTERY TEST OK, CHARGING SYSTEM DOES NOT CHARGE VEHICLE BATTERY. RECOMMEND TO REPLACE ALTERNATOR.

B.	TPS	INSPECT TIRE PRESSURES. ADJUST TO FACTORY SPECS.	Internal Pay	\$0.00
----	-----	--	--------------	--------

Job added by Anthony Matassa on Thu Feb 23, 2023 | 6:12 AM

TPS -INSPECT TIRE PRESSURES. ADJUST TO FACTORY SPECS. Labor \$0.00

1. CHECKED AND ADJUSTED VEHICLE TIRE PRESSURE AS REQUIRED.

C.	REC	DURING TESTING FOUND INTERMITTENT OUTPUT FAULTS WITH LIGHTING CONTROL MODULE.	Customer Pay	\$0.00
----	-----	---	--------------	--------

Job added by Anthony Matassa on Mon Feb 27, 2023 | 10:08 AM

REC -RECOMMENDATION Labor \$0.00

1. DURING INSPECTION IT WAS NOTED THAT THE RIGHT FRONT HEADLIGHT AND AT TIMES LEFT REAR TAIL LAMP ARE INTERMITTENTLY OUT. RECOMMEND TO REPLACE LIGHTING CONTROL MODULE, PART ON ORDER.

D.	REC	DURING INSPECTION FOUND TIRE PRESSURE SENSORS TO HAVE LOW REMAINING LIFE.	Customer Pay	\$1,302.92
----	-----	---	--------------	------------

Job added by Anthony Matassa on Mon Feb 27, 2023 | 10:08 AM



BAR# 1 | EPA# 1

© Tekion Corp 2023

Customer Copy v1 | Page 1 of 5  
Thu Mar 16, 2023 | 8:53 AM



# LAMBORGHINI BEVERLY HILLS

11401 W. Pico Blvd. Los Angeles, Ca. 90064

Customer Pay Invoice

**\$12,764.80**

RO# : 213553 | Tag# : 9422

Check-in: Thu Feb 23, 2023 | 6:12 AM

Ready for Pickup: Thu Mar 16, 2023 | 8:53 AM

Promise Time: Tue Feb 28, 2023 | 5:00 PM

**Customer**  
**WIRES ONLY**  
(323) 383-6040

**Billing-Customer**  
Same as Customer

**Vehicle**  
**2008 Lamborghini**  
**Reventon**  
**ZHWBC77S58LA03237**

**Service Advisor**  
**Anthony Matassa**

## REC -RECOMMENDATION

**Labor** \$295.00

1. DURING INSPECTION IT WAS NOTED THAT THE TPMS LIGHT FLASHES ON THE INSTRUMENT CLUSTER. USED LaRA TO VIEW DIAGNOSTIC CODES, ALL FOUR TPMS SENSOR BATTERY VOLTAGES LOW. REPLACED ALL FOUR TPMS SENSORS, TEST DROVE VEHICLE TO RESET TPMS SENSORS.

**Parts** \$1,007.92

7PP907275F - TYRE PRESSURE SENSOR 4 - \$1,007.92

**E. REC**

**DURING INSPECTION FOUND REAR VIEW MIRROR  
VISUAL OUTPUT FAULTS.**

**Customer Pay** **\$1,040.38**

Job added by Anthony Matassa on Mon Feb 27, 2023 | 10:08 AM

## REC -RECOMMENDATION

**Labor** \$620.00

1. DURING INSPECTION IT WAS NOTED THAT THE REAR VIEW MIRROR IS BEGGINING TO DELAMINATE, POTENTIAL AUTO-DIMMING FLUID LEAK ONTO CENTER CONSOLE IF NOT ADDRESSED. REPLACED REAR VIEW MIRROR ASSEMBLY.

**Parts** \$420.38

8L0857511 - REARVIEW MIRROR 1 - \$420.38 **SOR**

**F. REC**

**DURING INSPECTION FOUND TIRE SET REPLACEMENT  
REQUIRED DUE TO AGE.**

**Customer Pay** **\$1,760.91**

Job added by Anthony Matassa on Mon Feb 27, 2023 | 10:08 AM

## REC -RECOMMENDATION

**Labor** \$0.00

1. MOUNT AND BALANCED FOUR TIRES. SET TIRE PRESSURES, TEST DROVE VEHICLE TO RESET TPMS, SEE REPAIRS LINE "D"

**Parts** \$1,753.91

WW - WH/WEIGHTS 1 - \$13.91

03125140000 - 245/35ZR18 XL CONTINENTAL EXTREMECONTACT 2 - \$620.00

03125270000 - 335/30ZR18 CONTINENTAL EXTREMECONTACT 2 - \$1,120.00



BAR# 1 | EPA# 1  
© Tekion Corp 2023

Customer Copy v1 | Page 2 of 5  
Thu Mar 16, 2023 | 8:53 AM





# LAMBORGHINI BEVERLY HILLS

11401 W. Pico Blvd. Los Angeles, Ca. 90064

Customer Pay Invoice

**\$12,764.80**

RO# : 213553 | Tag# : 9422

Check-in: Thu Feb 23, 2023 | 6:12 AM

Ready for Pickup: Thu Mar 16, 2023 | 8:53 AM

Promise Time: Tue Feb 28, 2023 | 5:00 PM

**Customer**  
**WIRES ONLY**  
(323) 383-6040

**Billing-Customer**  
Same as Customer

**Vehicle**  
2008 Lamborghini  
Reventon  
ZHWBC77S58LA03237

**Service Advisor**  
Anthony Matassa

Fees \$7.00  
TT - Tire Tax - \$3.50  
TT - Tire Tax - \$3.50

G.	REC	DURING TESTING CONFIRMED FAILED ALTERNATOR PRESENT.	Customer Pay	\$8,605.82
----	-----	---	--------------	------------

Job added by Anthony Matassa on Mon Feb 27, 2023 | 10:08 AM

REC -RECOMMENDATION Labor \$3,100.00

1. AS PER LINE "A" REMOVED ENGINE CROSS BRACE AND ENGINE HARNESS FOR ACCESS, REPLACED ALTERNATOR. TEST DROVE VEHICLE TO CONFIRM REPAIR, CHARGING SYSTEM NOW CHARGES VEHICLE BATTERY AS EXPECTED AT THIS TIME.

Parts \$5,505.82  
07M903015 - ALTERNATOR 1 - \$5,505.82 **SOR**

H.	REC	DURING INSPECTION FOUND FAILED OUTPUT FOR LEFT DOOR STRUT.	Customer Pay	\$160.00
----	-----	--	--------------	----------

Job added by Anthony Matassa on Mon Feb 27, 2023 | 10:08 AM

REC -RECOMMENDATION Labor \$0.00

1. DURING INSPECTION IT WAS NOTED THAT THE DRIVER DOOR STRUT IS WEAK TO HOLD DRIVER DOOR OPEN. REMOVED DRIVER INTERIOR DOOR PANEL FOR ACCESS, REPLACED DRIVER DOOR STRUT.

Parts \$160.00  
410837987 - SHOCK ABSORBER 1 - \$160.00

I.	REC	PERFORM LUBE, OIL, FILTER SERVICE.	Customer Pay	\$1,308.96
----	-----	------------------------------------	--------------	------------

Job added by Anthony Matassa on Mon Feb 27, 2023 | 10:08 AM

REC -RECOMMENDATION Labor \$930.00

1. PERFORMED LUBE OIL FILTER. TEST DROVE VEHICLE TO SET OIL LEVEL AND CONFIRM REPAIR.





LAMBORGHINI  
BEVERLY HILLS

11401 W. Pico Blvd. Los Angeles, Ca. 90064

Customer Pay Invoice  
\$12,764.80

RO# : 213553 | Tag# : 9422

Check-in: Thu Feb 23, 2023 | 6:12 AM  
Ready for Pickup: Thu Mar 16, 2023 | 8:53 AM  
Promise Time: Tue Feb 28, 2023 | 5:00 PM

Customer	Billing-Customer	Vehicle	Service Advisor
WIRES ONLY	Same as Customer	2008 Lamborghini	Anthony Matassa
(323) 383-6040		Reventon	
		ZHWBC77S58LA03237	

Parts	\$348.96
MOC1080 - PARTS WASH 1 - \$16.44	
N0138481 - WASHER 2 - \$1.60	
CAST5W40 - OIL5W40 14 - \$279.16	
07M115561B - SPIN-ON FILTER CARTUCCIS FIL.OLIO 1 - \$51.76	

Fees	\$30.00
HWLA - Hazardous Waste Lamborghini - \$17.00	
MPLA - Misc / Part Lamborghini - \$13.00	

Additional Discount	Discount Amount
10LAPS	\$1,414.19

	Labor	\$4,945.00
	Parts	\$9,196.99
	Sublet Labor	\$0.00
	Sublet Parts	\$0.00
	Fees	\$37.00
	Discounts	- \$1,414.19
	Tax	\$0.00
	Deductible	\$0.00
	Invoice Total	\$12,764.80
Original Estimate		
Thu Feb 23, 2023   6:12 AM	\$0.00	





# LAMBORGHINI BEVERLY HILLS

11401 W. Pico Blvd. Los Angeles, Ca. 90064

Customer Pay Invoice

**\$12,764.80**

RO# : 213553 | Tag# : 9422

Check-in: Thu Feb 23, 2023 | 6:12 AM

Ready for Pickup: Thu Mar 16, 2023 | 8:53 AM

Promise Time: Tue Feb 28, 2023 | 5:00 PM

**Customer**  
**WIRES ONLY**  
(323) 383-6040

**Billing-Customer**  
Same as Customer

**Vehicle**  
**2008 Lamborghini**  
**Reventon**  
**ZHWBC77S58LA03237**

**Service Advisor**  
**Anthony Matassa**

Original Estimate (Parts & Labor)	Total Additional Cost Authorized	Approved By	Date & Time	Authorization Obtained By
\$	\$			<input type="checkbox"/> Telephone <input type="text"/> <input type="checkbox"/> Text <input type="text"/> <input type="checkbox"/> Fax (See Attached) <input type="checkbox"/> E-mail (See Attached)
Revised Estimate \$	\$			<input type="checkbox"/> Telephone <input type="text"/> <input type="checkbox"/> Text <input type="text"/> <input type="checkbox"/> Fax (See Attached) <input type="checkbox"/> E-mail (See Attached)

## SA Notes

Anthony Matassa approved recommendations on behalf of WIRES ONLY Wires only.

Mode Of Communication	Previous Estimate	Revised Estimate	Date and Time
Call	\$0.00	\$15,743.99	Mon Feb 27, 2023 at 10:07 AM

Note  
approved

By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you.

Customer Signature

Service Advisor Signature

**Invoice Date**  
Thu Feb 23, 2023 | 6:12 AM



BAR# 1 | EPA# 1  
© Tekion Corp 2023

Customer Copy v1 | Page 5 of 5  
Thu Mar 16, 2023 | 8:53 AM